

# 2011–2017 Nissan Juke 1.6 L4 Engine Turbocharger 2511519 & Oil Feed Line 2541237

When installing a new turbo unit on 2011–2017 Nissan Juke 1.6 L4 engine models, gpd highly recommends replacing the oil feed line.



2511519  
2011–2017 Nissan Juke  
Turbocharger



2541237  
2011–2017 Nissan Juke  
Oil Feed Line

These Nissan Juke models are designed with the oil feed line close to the exhaust. Excessive heat from the exhaust accelerates the breakdown of inner hose material, creating a restriction in the oil feed line. In most cases, flushing is ineffective for this type of restriction. Thus, the oil feed line should be replaced to ensure necessary oil flow and lubrication of the turbo unit. As lack of lubrication is detrimental to turbo performance, failure to replace the oil feed line in this scenario can cause various turbo failures. It should also be noted that turbo failure due to restricted oil feed line is not covered under the manufacturer's warranty.

Refer to gpd Tech Tip #189 for guidance on turbocharger installation and common reasons for failure.

Manufacturer names, logos and part numbers are for reference only. All prices, taxes and availability are subject to change without notice. This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to which they are addressed. If you have received this document in error, please delete it immediately. Note that any views or opinions presented in this document are solely those of the author. Any unauthorized review, use, disclosure, or distribution is prohibited. Global Parts Distributors, LLC (gpd) accepts no liability for any damage caused by any virus or other means transmitted by this document. © Global Parts Distributors, LLC (gpd)

**gpd.**

Global Parts Distributors, LLC

**TECH TIP**

#210

gpdtechtips.com